DG Flugzeugbau GmbH
76646 Bruchsal


Service Info
No. 55-04

Subject : Landing gear control – side cover in rear cockpit

Effectivity : DG-1000S, all ser. no.'s

Accomplishment : If possible prior to next take-off

Reason : If the landing gear operating handle is rotated very far into the cockpit, the locking latch at the push rod may interfere with the side cover.

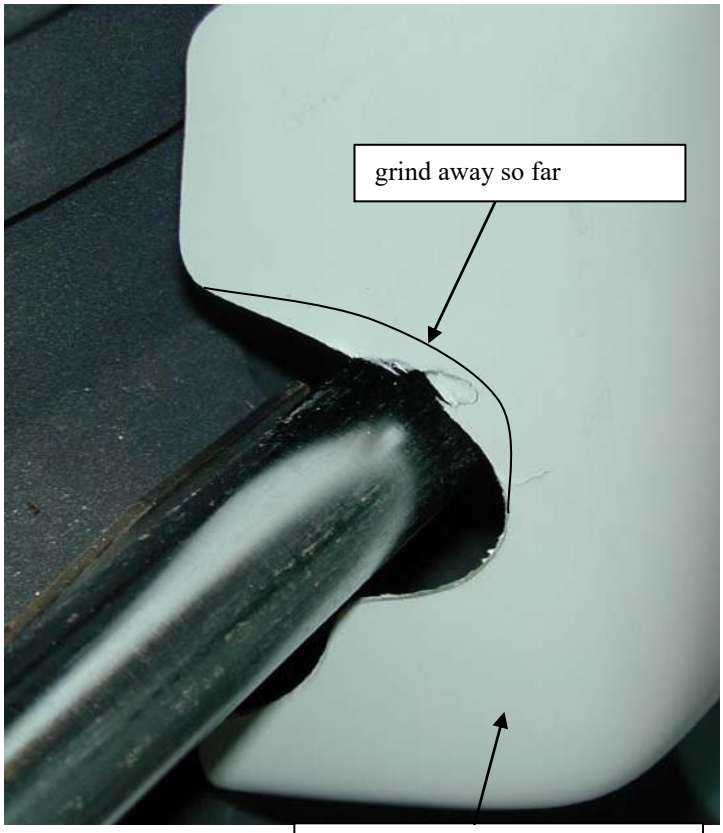

side cover in rear cockpit left hand side, front part

Instructions : Extend the landing gear so far, that the locking latch is located directly at the side cover. Rotate the operating handle and mark it's position on the side cover. Remove the side cover and grind away so much, that the locking latch has 3mm clearance in it's most unfavourable position, see sketch.

Material : /

Remarks : Instructions may be executed by the owner himself.

Bruchsal, date:
June 14. 2004

Author:
Dipl. Ing. Wilhelm Dirks